

## To valued customers:

February 2015  
Hakko Electronics Co., Ltd.

### Defect report: V8/TS series – System program defect

We regretfully inform you that the problem was verified with V8 and TS series as below.  
You will need to upgrade the system program of your V8/TS units.  
Following are the details of the problem for your perusal.

#### 1. Problem

The data stored in the SRAM may be altered unintentionally.  
Because of this issue, "SRAM format error 161" may occur after cycling the power of the V8/TS unit.

#### 2. Scope of the product

Applicable models:

All V8 series and TS series

System program:

From the version 2.050 (released on August 1, 2014) to 2.080 (released on January 9, 2015.)

Applicable screen configuration software packages:

V-SFT-5: From the version 5.4.36.0 (released on Aug 1, 2014) to 5.4.38.0 (released on Jan 9, 2015)

V-SFT-6: From the version 6.0.5.0 (released on Jan 9, 2015) to 6.0.6.0 (released on Feb 4, 2015)

#### 3. Conditions to occur the problem

The problem occurs when ALL the conditions below are fulfilled.

1/ SRAM area is used and its remaining capacity is less than 1024 words.

2/ "Use operation log function" is not checked. Alternatively, "Use operation log function" is checked but "CF card Writing Error" option is not checked.

3/ Any of the macro commands or functions listed below are executed.

<Macro commands>

COPY\_FILE, MOVE\_FILE,

WR\_RECIPE\_COLUMN, WR\_RECIPE\_LINE, WR\_RECIPE\_FILE,

SV\_RECIPE, SV\_RECIPE2,

SMPL\_BAK, SMPL\_CSV, SMPLCSV\_BAK, SMPLCSV\_BAK2, SMPL\_CSV2

<Function: Recipe>

[Function: Transfer PLC > Card] switch, [Function: Edit] switch

<Function: Sampling>

CSV output, generating backup files

4/ Power off and on the Monitouch.

#### 4. Cause of the defect

It is caused by the defect of the system program of V8/TS series, which came from adding a new function with the version 2.050.

#### 5. Bug fix schedule

Upgrading of V8/TS system program is scheduled as follows:

- 1) V810(i)Tx, V810(i)Sx, V812(i)Sx, V808(i)CH, V815iXx

V8 system program version 2.080 >> **Ver.2.090**

**Production starting from Feb 16, 2015 and later.**

- 2) V806(i)MD, V806(i)CD, V806(i)TD, V808(i)CD, V808(i)SD, V810(i)Cx,  
TS1070i, TS1071i, TS1100i, TS1101i

V8 system program version 2.080 >> **Ver.2.090**

**Production starting from March 2015 and later.**

- 3) Screen configuration software V-SFT Ver.5.4.38.0 >> **Ver.5.4.39.0**

**Product shipped on Feb 16, 2015 and later.**

- 4) Screen configuration software V-SFT Ver.6.0.6.0 >> **Ver.6.0.7.0**

**Product shipped on Feb 20, 2015 and later.**

#### 6. Request to the customers

Please download the latest version of V-SFT from our website and upgrade the system program of the V8/TS unit.

Schedule:

V-SFT Ver5: February 16, 2015

V-SFT Ver6: February 20, 2015

URL: <http://monitouch.fujielectric.com/>

V-SFT Ver5: Support > Download > V-SFT > MONITOUCH V8 series > Configuration software

V-SFT Ver6: Support > Download > V-SFT > MONITOUCH V9 series > Configuration software

Search Human machine Interface(POD) Documents Software

---

Select the document's product group, manual type, and category in order from the top to display a list of the search results.

Productgroup:   
 Manualtype:   
 Category:

\*When there are a large number of search results it may take time before the search results can be displayed.